

Date: Friday, 9/1/2006 12:03:38 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 A/B HIGH GEAR SKIDTUBE
 Job Number : 28384
 Estimate Number : 10161
 P.O. Number : N/A Part Number : D206642211
 This Issue : 9/1/2006 S.O. No. : N/A Drawing Number : N/A
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : N/A
 Previous Run : 28383 Material : N/A
 Written By : Due Date : 9/20/2006 Qty: 1 Um: Each
 Checked & Approved By : KS 06.09.01
 Comment : Est Rev:J 04.08.06 Revised Step 4 per CHG003 KJ/JLMJ 0
 4.08.06

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL
 Photocopy bluefile & type labels per PPP206-642-211 CHG004

KS 06.09.06 ①

2.0 28384A HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B



Comment: Sub-Component HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
 D206-642-241 B 28384A

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
 Pick Packing Kit

4.0 D206651041 206 A/B GHW Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 Pick: Packing Kit

✓ Qty Part Number Description Batch
 1 D206-651-041 GHW Kit B24192-

5.0 D2652 Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)
 Pick: Packing Kit

✓ Qty Part Number Description Batch
 16 D2652 Bushing B26252 15X B28402 1X

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:03:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28384

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2655

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 1 D2655 Tow Ring B27110

7.0

D26651

Saddle, LH Fwd Aft Out



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 2 D2665-1 Saddle B25915

8.0

D26661

Saddle, LH, Fwd, Aft, In



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 2 D2666-1 Saddle B23922 1x B27770 1x

9.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 10 D2712 Set Screw B26481

10.0

D2884

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

SADDLE SPACER

Batch: 28259

11.0

D2885

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Saddle Spacer

✓ B23526 1x

✓ B27969 1x

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:03:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28384

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 8 AN3-41A

Bolt M102339 -

13.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 1 AN4-5A

Bolt M100857 -

14.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 12 AN4-6A

Bolt M101418 -

15.0

AN57A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 4 AN5-7A

Bolt M102140 -

16.0

AN511A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 4 AN5-11A

Bolt M102404 -

17.0

AN644A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 2 AN6-44A

Bolt M100447 -

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:03:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28384

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

AN960JD10

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 8 AN960JD10

Washer M100743-

19.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 25 AN960JD416

Washer M102339-

20.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 8 AN960JD516

Washer M102328-

21.0

AN960JD616

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 4 AN960JD616

Washer M101124-

22.0

MS21042L3

Nut



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 8 MS21042L3

Nut (or -3) M101917-

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: DP Date: 06/11/15

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:03:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28384

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

MS21042L4

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 12 MS21042L4 Nut (or -4) M19185-

24.0

MS21042L6

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

✓ 2 MS21042L6 Nut (or -6) M100151-

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-211

Location:

REV D B 06/11/14 (1)

27.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

SD 06/11/15 (1)

Job Completion



W 06.11.15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:42 PM
User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
Job Number : 28384A
Estimate Number : 10163
P.O. Number : *N/A* Part Number : D206642241
This Issue : 9/1/2006 S.O. No. : *N/A* Drawing Number : D2650 REV E P1,3
Prsht Rev. : NC Project Number : N/A
First Issue : *N/A* Type : LANDING GEAR Drawing Revision : E
Previous Run : 28383A Material : *N/A*
Written By : Due Date : 9/20/2006 Qty: 1 Um: Each
Checked & Approved By : *06-09-01*
Comment : Est Rev:M 04/12/02 Revised procedural steps KJ/JLM

Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description :

1.0 DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-241 CHG003

N/A

2.0

D2620

Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2620 Bent Tube 3" OD *B27831**DP 6-9-5*

3.0

D32861

Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 D3286-1 Doubler *B27594**DE 06-10-10*

4.0

D2647

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2647 Fwd Cap *B24842**BE 06-09-11*

5.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

DP 6-9-5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:42 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

DP 6-9-5

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod m10/655 / m10/1010 BE 6-9-11

4-Grind weld flush to cap on top surface only. pm 06-09-200

5-Cut Aft end as per dwg 2650 from front of tube and Deburr pm 06-9-200

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

DP 6-9-28

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support. BE 06-10-10

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time. BE 06-10-10

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads. BE 06-10-10

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650 BE 06-10-10

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder BE 06-10-10

14-Remove indexing edge using DT8741 as per Dwg D2650 BE 06-10-10

15-C'sink GHW rivet holes as per Dwg D2650

BE 06-10-10

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

06-10-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: - _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:42 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

BE 06-10-11

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

BE 06-10-11

3-Deburr tube and blow out chips from inside the tube

BE 06-10-11

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

M-L 06/10/12

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 6-10-19

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

BE 6-10-19

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

BE 6-10-19

3-Deburr and blow out all chips from inside the tube

BE 6-10-19

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

DP 6-10-19

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet

BE BE6-10-19
M 102092

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:43 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

B29008

Pm 06-10-20(1)

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

BE 6-10-19

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 06-10-20 Time: 9:00am

Finish Date: 06-10-23 Time: 7:30am

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291

m 62107

Sikaflex expire date:

07-02-01

Pm 06-10-20(1)

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

m 28250 BE 06-10-23

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

B 24711 BE 06-10-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:43 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M101010 BE 06-10-23 (1)

2-Grind welds flush as per Dwg D2650. Pm' 06-10-24 (1)

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/R SS Rod NONE USED BE 06-10-27

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Debur Pm' 06-10-27 (1)

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets M101938 Pm' 06-10-27 (2)

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets M19099 Pm' 06-10-27 (2)

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate B24203 Pm' 06-10-27 (1)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:43 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

Pmt 06-10-27 (1)

23.0

QC5/9

WELD INSPECTION



Comment: Inspect weld and Counterbore work to Current Step. Inspect for foreign objects as per QSI 024

24.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

*yl 06/11/07 x1
M101575*

25.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 06 11 07 (1)

26.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

27169

27.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

27739

28.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

27075

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:43 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-33

Wearshoe

28179

30.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

~~27169~~ 29201

31.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 ALS4-1032-130 Inserts

18990

or (see QSI 017)

32.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 AN960JD10L

Washer

100233

33.0

MS27039108

Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 MS27039-1-08

Screw

102984

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:43 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

34.0	D26511	Plug
------	--------	------



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
18	D2651-1	Plugs	28691

35.0	D26513	O-Ring
------	--------	--------



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
18	D2651-3	O-Rings	28401

36.0	MS27039406	Screw
------	------------	-------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	MS27039-4-06	Screw	6874

37.0	AN960JD416	Washer
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	AN960JD416	Washer	11151

38.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291 102107
Sikaflex expire date: 02/07

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:43 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

39.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP
Inspect for foreign objects as per QSI 024

FL 06 11 07 (1)

40.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Pick:
Qty Part Number Description Batch
1 D2646 Aft Cap 28041

41.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Pick:
Qty Part Number Description Batch
2 MS27039-1-08 Screw 102404

42.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Pick:
Qty Part Number Description Batch
2 AN960JD10L Washer 100233

43.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive
A/R Sikaflex-291 102107
Sikaflex expire date: 02/07

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4
Batch: 102098

yl 06/11/07 x1
yl 06/11/08 x1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:04:44 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28384A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

44.0

QC3/5

INSPECT WORK/WING WALK



Comment: INSPECT WORK/WING WALK

N/A 06/11/13 (1)

45.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location: _____

PPP Rev: _____

N/A

46.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

(1)
06/11/15

Job Completion



06-11-15

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>14</i>	DRAWN BY <i>10</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>11</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES SCALE NTS	
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED

16 04 17 *11*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET




NOTES

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH:
-CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO 28384A

Copyright © 1997 by DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

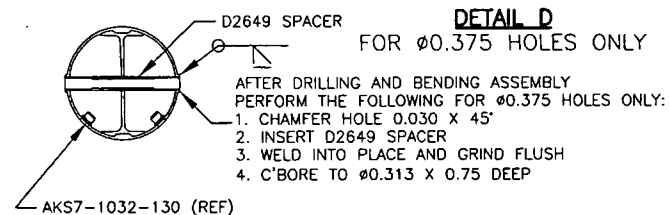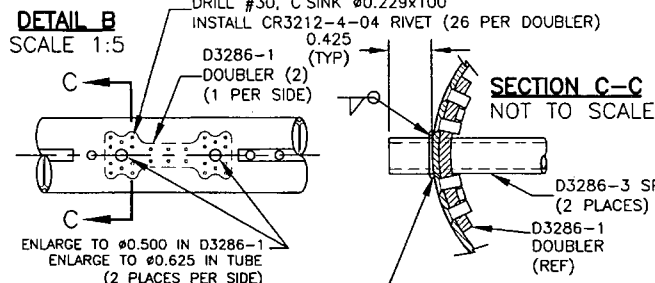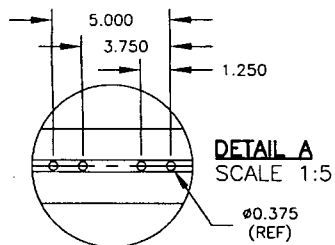

RELEASED

06.04.07

- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO $\phi 0.500$
 4. ENLARGE HOLES IN TUBE TO $\phi 0.625$ AND CHAMFER HOLE $0.030 \times 45^\circ$
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

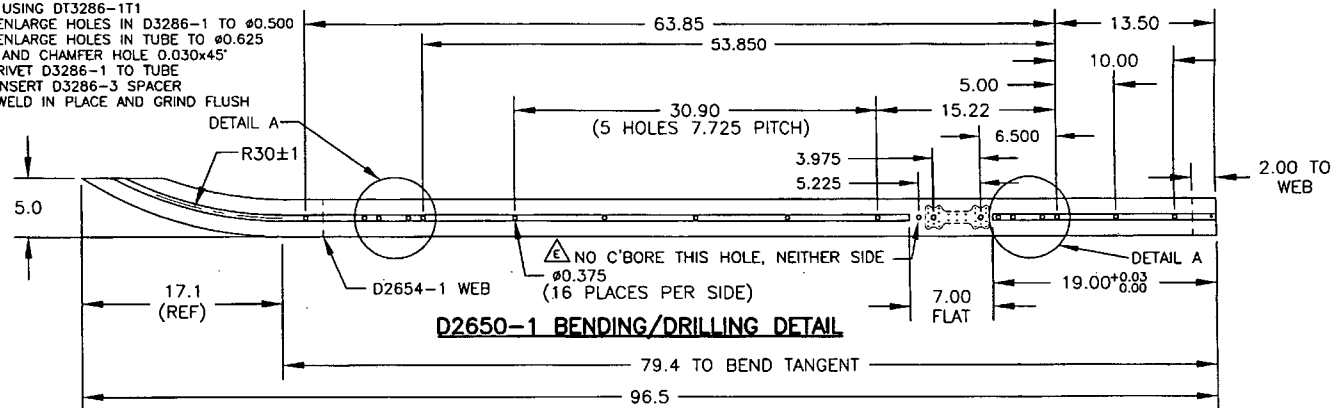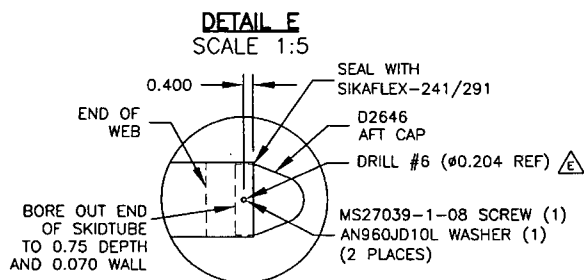


DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

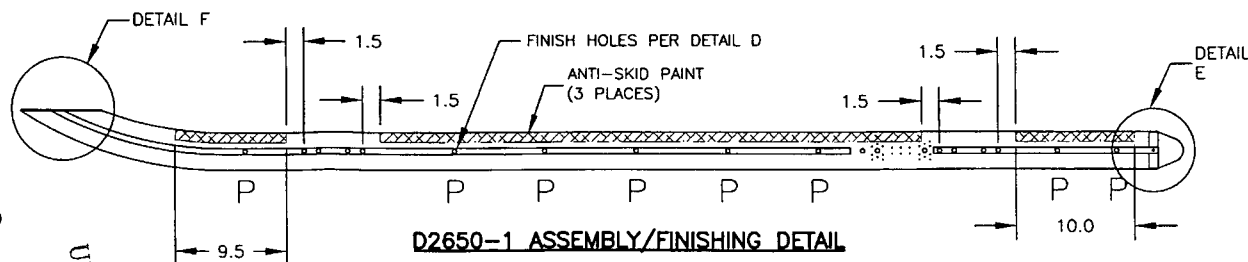




COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	CP	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	REV. E
CHECKED	PH	APPROVED	H	DRAWING NO. D2650	SHEET 2 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10





NO. 23384A
WORK ORDER
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE



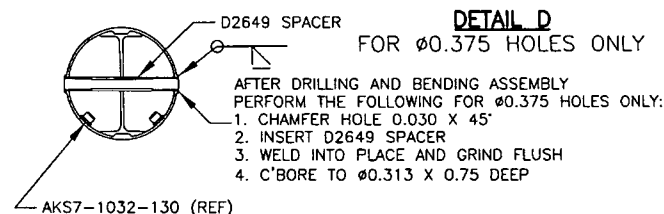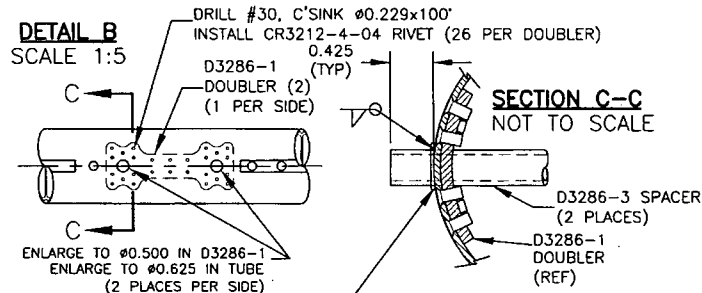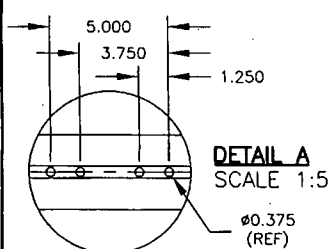

RELEASED
26-04-7

- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO 0.500
 4. ENLARGE HOLES IN TUBE TO 0.625 AND CHAMFER HOLE 0.030x45°
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

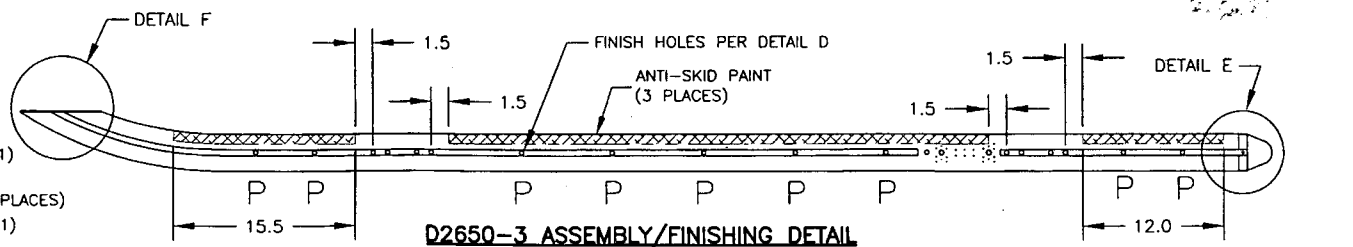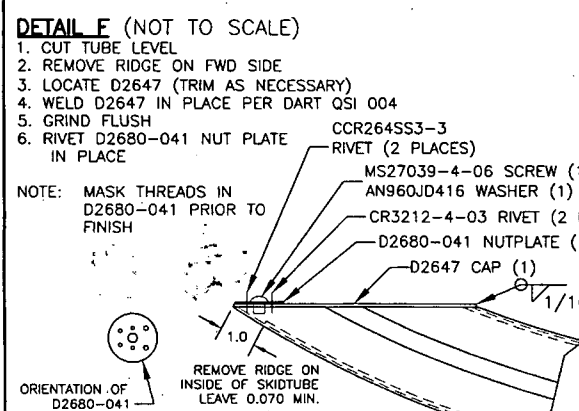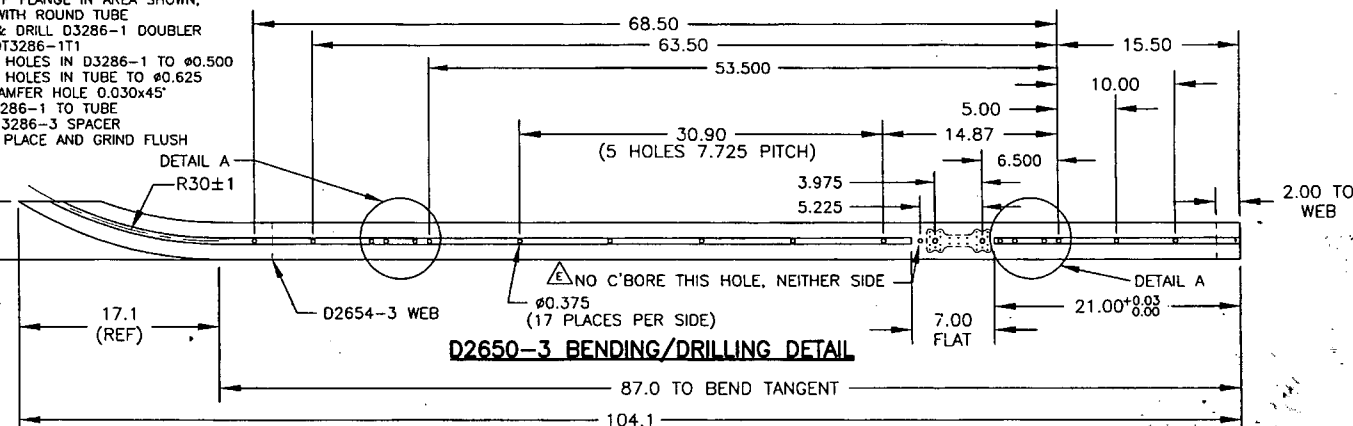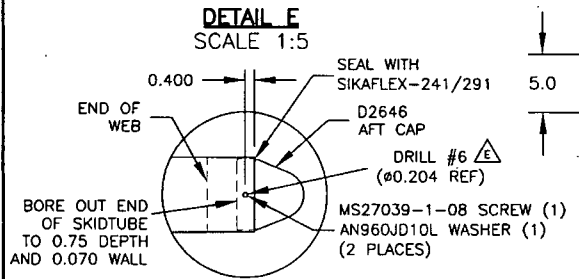

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

ORIENTATION OF D2680-041

REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

MS27039-4-06 SCREW (1)
AN960JD416 WASHER (1)
CR3212-4-03 RIVET (2 PLACES)
D2680-041 NUTPLATE (1)
D2647 CAP (1)

CCR264SS3-3 RIVET (2 PLACES)

283244

NO. 283244

WORK ORDER

UNCONTROLLED COPY

SUBJECT TO AMENDMENT




WITHOUT NOTICE

SHOP COPY

RETURN TO

ENGINEERING



COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	UP	DRAWN BY	UP	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	PH	APPROVED	PH	DRAWING NO. D2650	REV. E
		DATE	06.03.30			TITLE SKIDTUBE	SHEET 3 OF 5
						SCALE	1:10

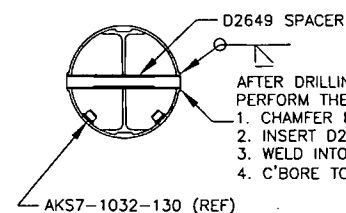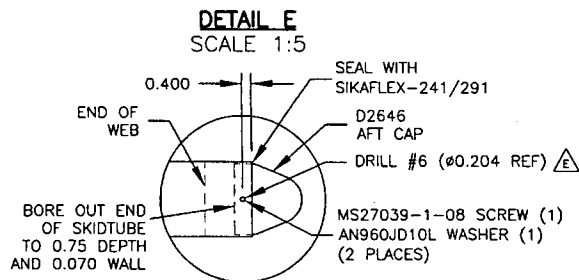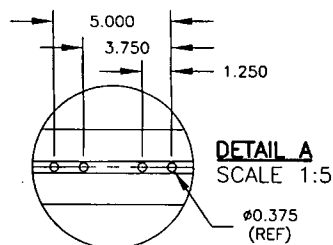

AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:

1. CHAMFER HOLE 0.030 X 45°
2. INSERT D2649 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE TO Ø0.313 X 0.75 DEEP


RELEASED

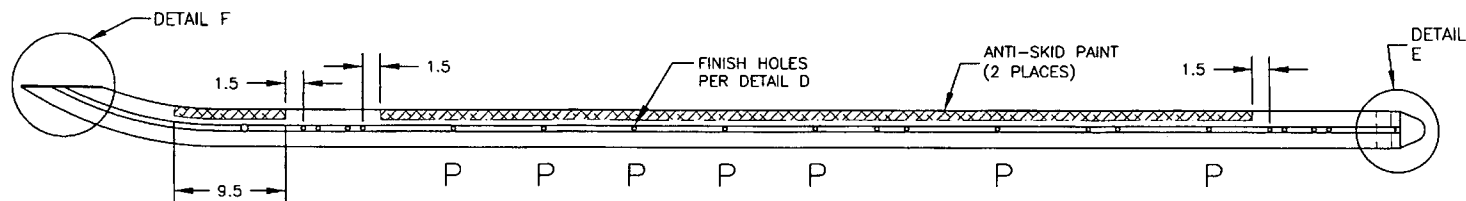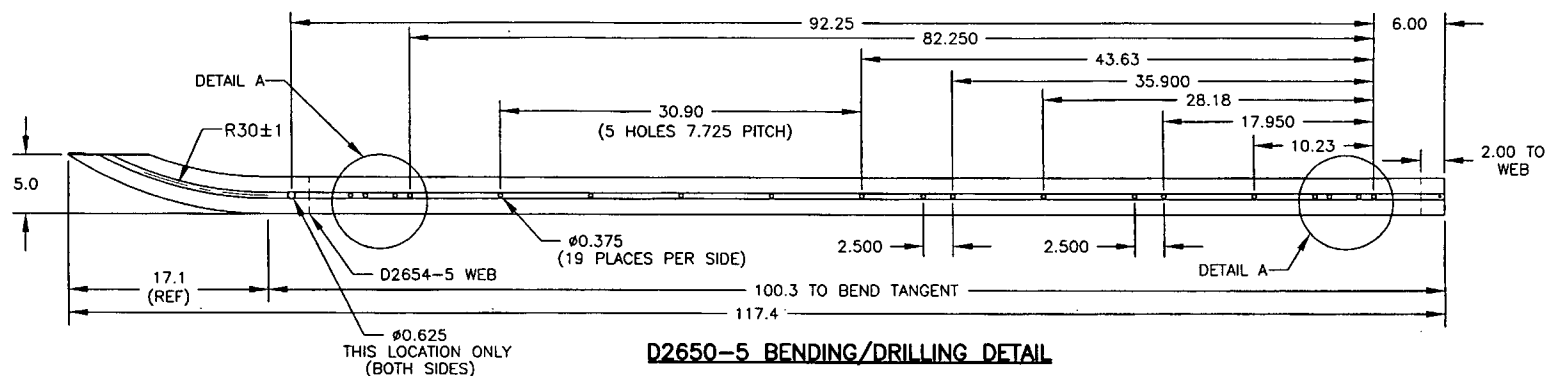

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH









REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

- CCR264SS3-3 RIVET (2 PLACES)
- MS27039-4-06 SCREW (1)
- AN960JD416 WASHER (1)
- CR3212-4-03 RIVET (2 PLACES)
- D2680-041 NUTPLATE (1)
- D2647 CAP (1)

NO. 283844
WORK ORDER
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
WITHOUT NOTICE

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED PH	APPROVED H	DRAWING NO. D2650	REV. E SHEET 4 OF 5
		DATE 06.03.30	TITLE SKIDTUBE		SCALE 1:10

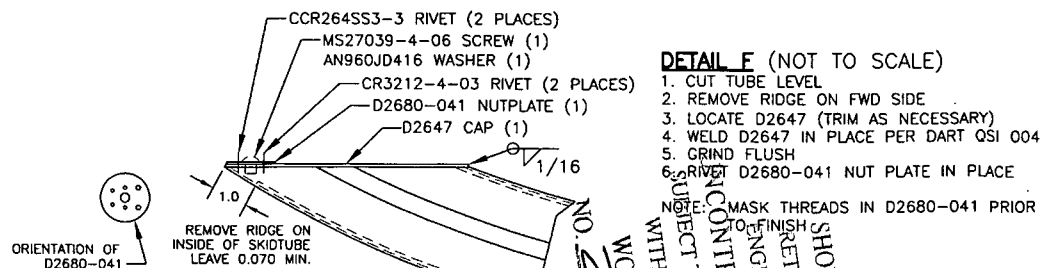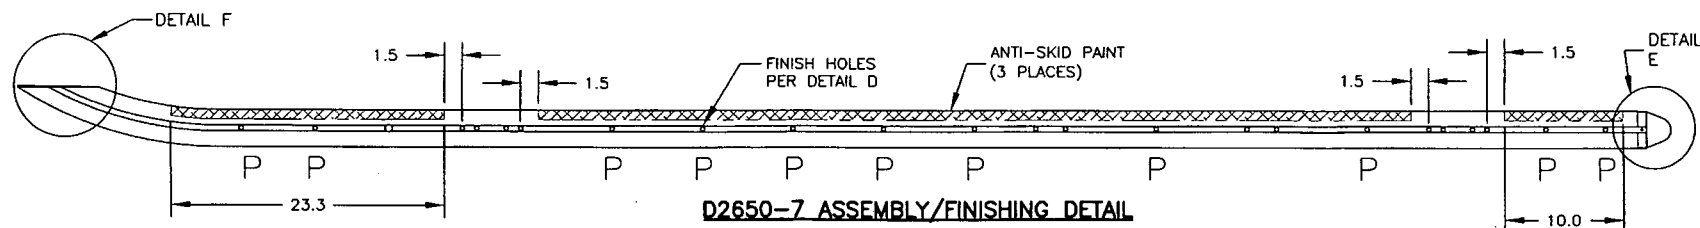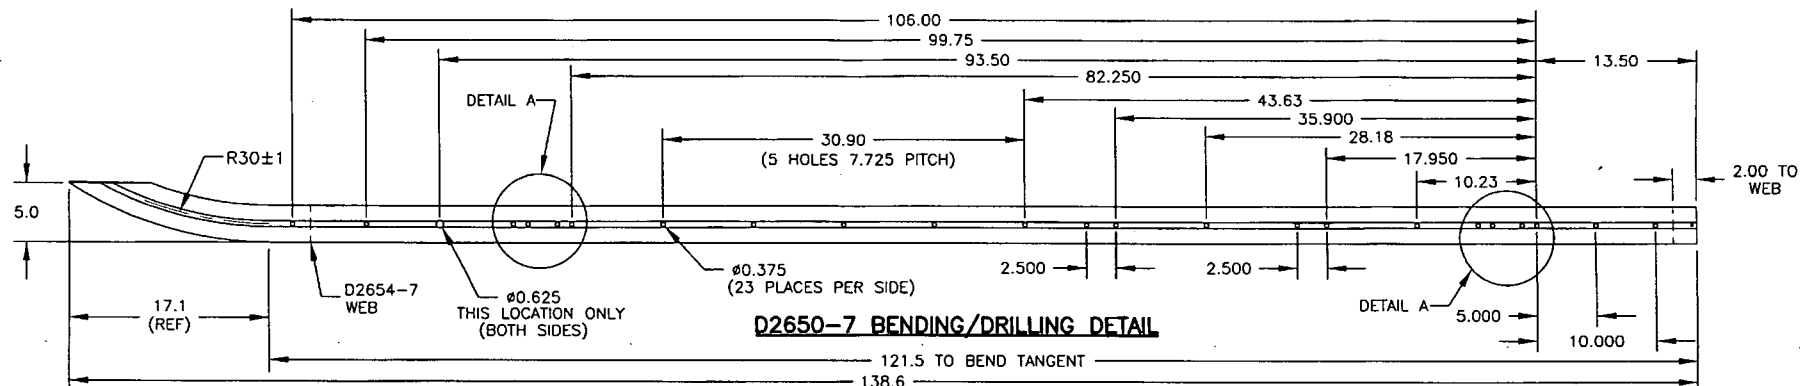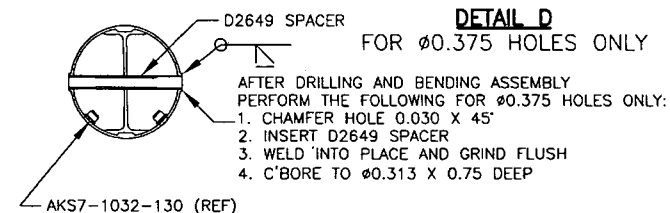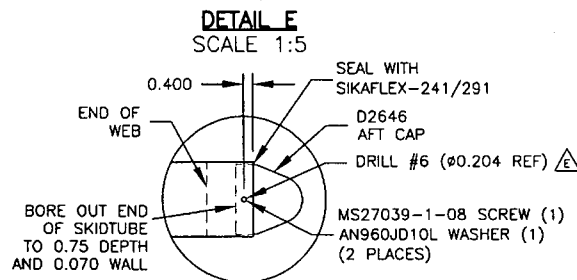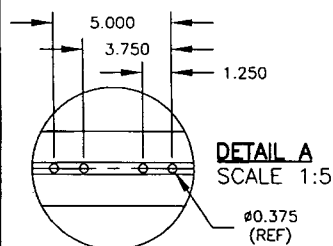

- DETAIL E (NOT TO SCALE)**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D2647 (TRIM AS NECESSARY)
 4. WELD D2647 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	UP	DRAWN BY	UP	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. E
CHECKED	PH	APPROVED	PH	DRAWING NO. D2650	SHEET 5 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10

RELEASED
06.04.17

NO. 28384A
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
CONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

NO. 38

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A206642241 / B28155A

TEST WELDS REQUIRED

BASE METAL	<u>Alum</u>	WELDING PROCESS	<u>Tig</u>
Penetration	Complete <input type="checkbox"/> Partial <input checked="" type="checkbox"/>	Single Weld <input checked="" type="checkbox"/> Double Weld <input type="checkbox"/>	
Current	AC <input checked="" type="checkbox"/> DC <input type="checkbox"/>	Backing	YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
	Position	Vertical	Down <input type="checkbox"/> Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/> 2G <input type="checkbox"/> 3G <input type="checkbox"/> 4G <input type="checkbox"/>		
Tube Groove	1G <input type="checkbox"/> 2G <input type="checkbox"/> 5G <input type="checkbox"/> 6G <input type="checkbox"/>		
Sheet Fillet	1F <input type="checkbox"/> 2F <input type="checkbox"/> 3F <input type="checkbox"/> 4F <input type="checkbox"/>		
Tube Fillet	1F <input type="checkbox"/> 2F <input type="checkbox"/> 4F <input type="checkbox"/> 5F <input type="checkbox"/>		
Crossbolt Spacer	Welded into		Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 06/10/23 Qualifier Daniel Sual

